



Here are some pictures as requested. This is the roller and the intermediate gear, it is hard to see but there is still an 1/8 inch between the roller and gear.

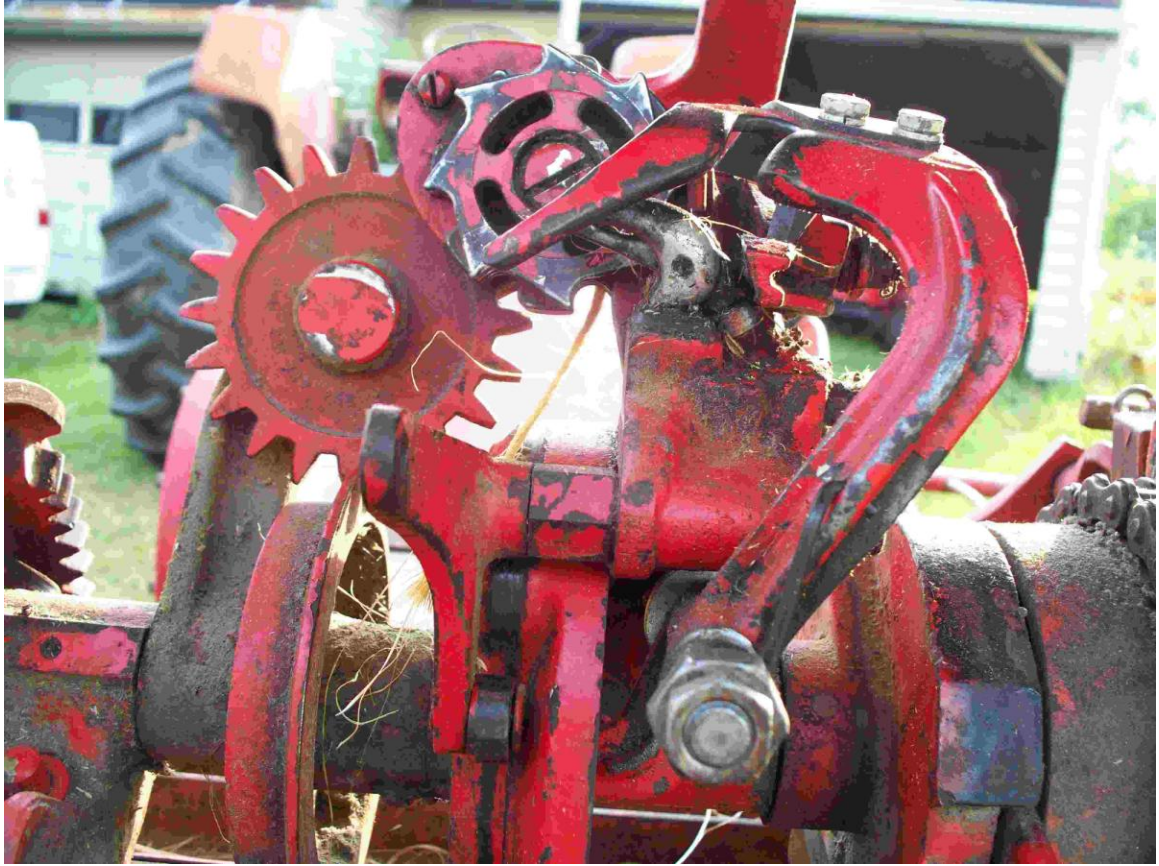

The problem I see is shown in the next two pictures. The twine knife is resting against the bill hook guide (plate that puts pressure on the bill hook as it rotates), instead of the roller contacting the intermediate gear. This limits my travel of the twine knife and it does not clear the end of the bill hook by the 3/8 to 1/2 inch as indicated in the manual.



Here are some front shots of the pins and wiper arms. This one is the non working.

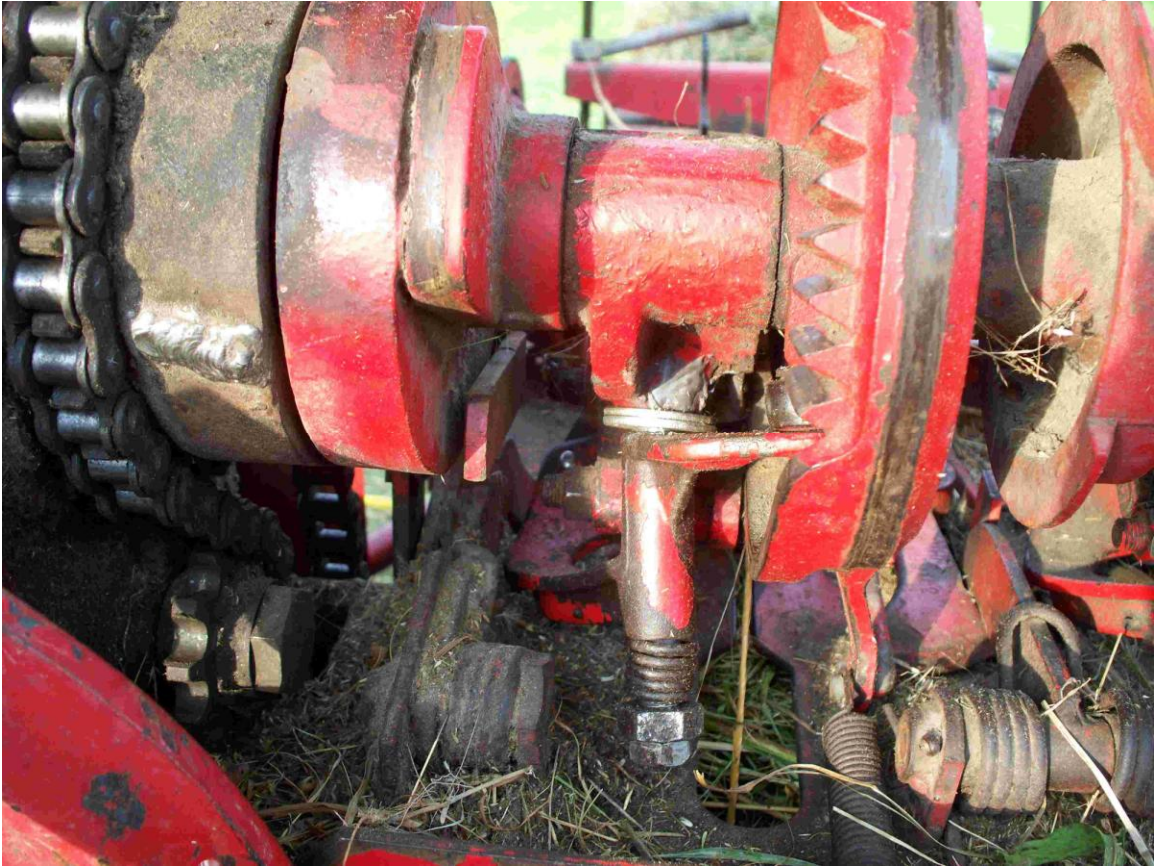

This one is the working one. You can see the difference in roller positions. This one the roller is fully inside the intermediate gear.

