


Fault Code: P0641


Dashboard Fault Code : s1079 F11

Lamp	Title	Cause
RED Blink 1Hz 	ECU Internal 5V Supply 1 fault	Sensor Supply 1- Loss of regulation

Influences on vehicle

1. Engine torque reduce

Circuit Diagram

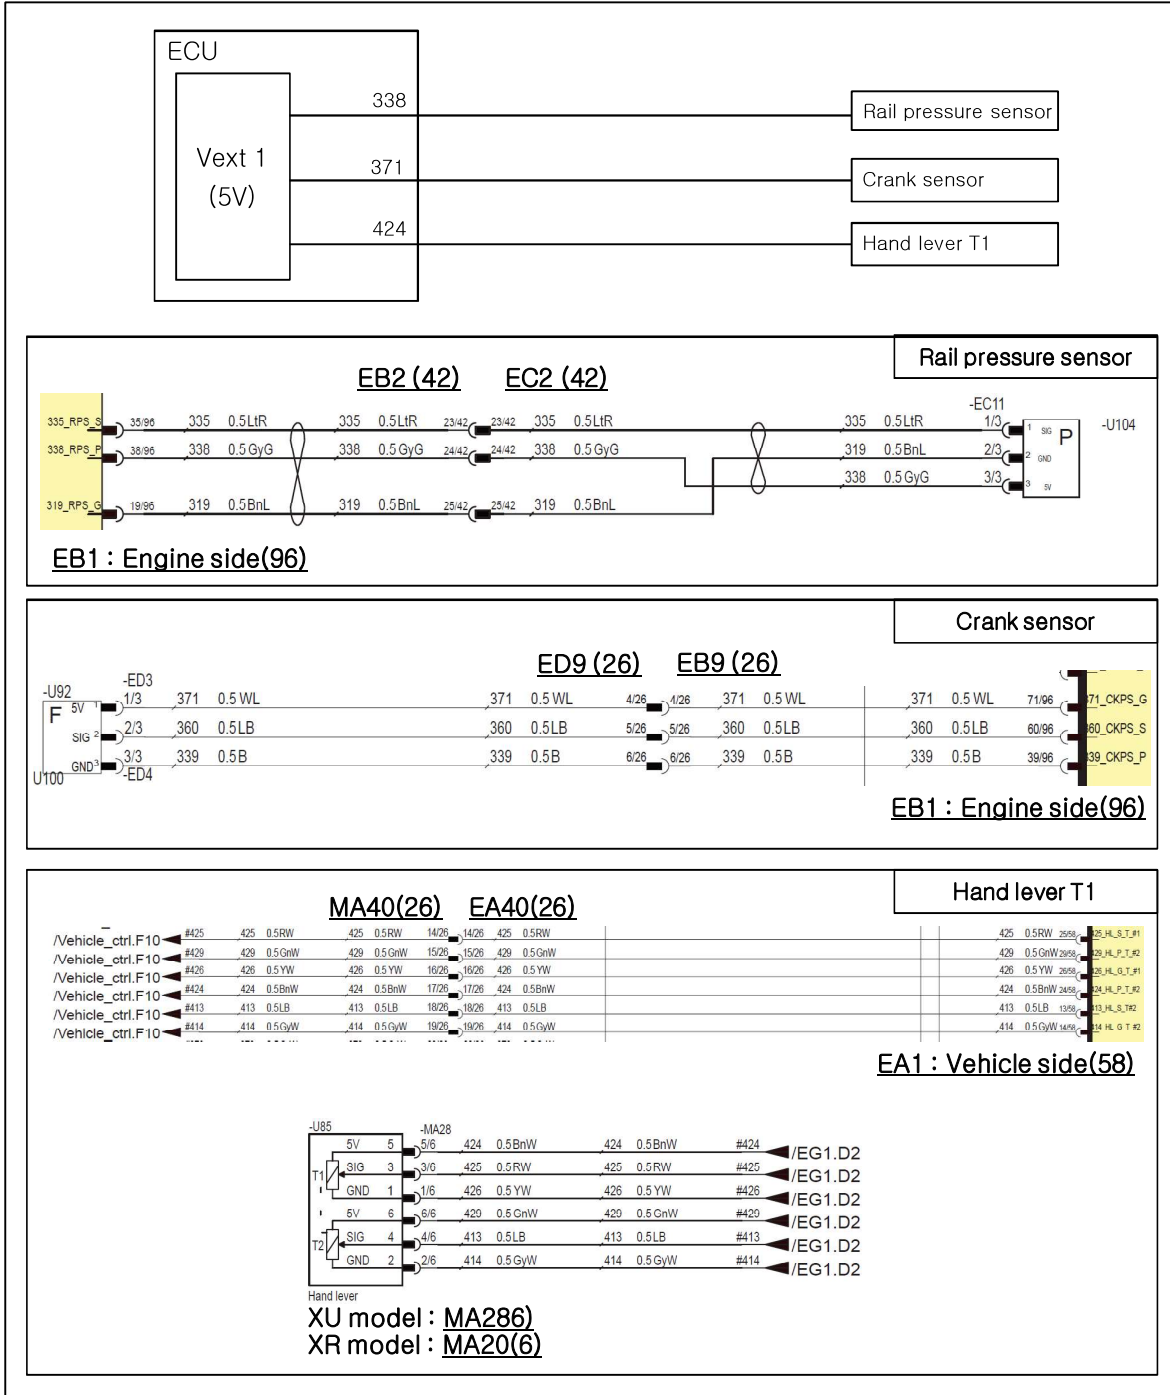

Maintenance Procedure

Stage	Check List	Corrective Measure	
		Yes	No
1	Read Fault Code. Fault code of all corresponding sensors connected to this Vext ?	Go to stage 2	Go to stage 3
2	Problem with one of these sensors causing loss of Vext: Disconnect sensors one by one checking if fault disappear to find which one is faulty. If None is found faulty, check short circuit and isolation of Vext lines on the harness. Check the problem?	Perform necessary repair	Call Hot-line
3	Connection conform. Problem still present ?	Call Hot-line	Problem solved